SAFETY NOTICE

i12010S **i12010SCO** **KN-COSM-IBA (900-0114A)**

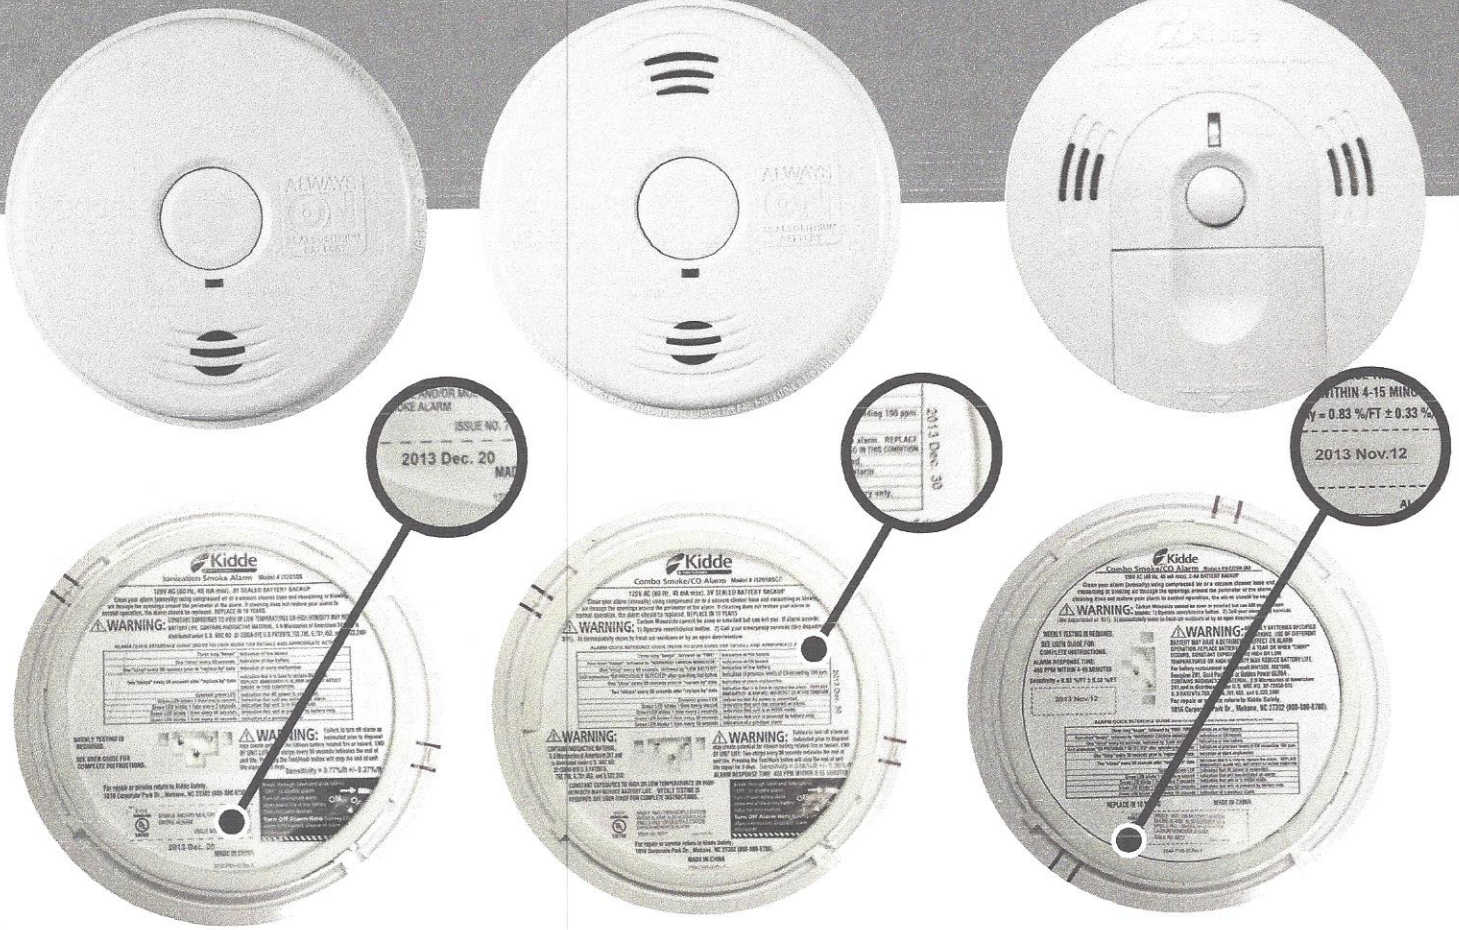

Name of Products:

i12010S –10 Year Hardwired Smoke Alarm – manufactured 12/18/13 through 5/13/14

i12010SCO – 10 Year Hardwired Combination Smoke/Carbon Monoxide Alarm – manufactured 12/30/13 through 5/13/14

KN-COSM-IBA – Combination Smoke/Carbon Monoxide Alarm (front-load battery model only) – manufactured from 10/22/13 through 5/13/14

These units are AC/DC powered and capable of hardwired interconnect. They have a Kidde logo on the face of the unit. The model number is on the label on the back of the unit.

Identified Hazard: If a power outage occurs at the same second that a unit is performing a sensor health check, the unit may go into a "latched" mode, causing it not to alert to the presence of smoke. It will sound if it receives a signal from an alarm in the same interconnected system. Once power is restored, a latched unit will sound an alert, regardless of the presence of fire and/or carbon monoxide (for combination units) until power to the unit is completely removed.

Remedy: Replace Unit. Consumers should not take the alarm out of service until they receive a replacement from Kidde.

Kidde Product Support: Kidde toll-free at 1-844-553-9011 between 8:00 a.m. – 5:00 p.m. EST Monday through Friday, except holidays, or visit our website at www.kidde.com. Calls consumers may have of a technical nature that are not related to the recall should be transferred to our toll free number.

Post until January 11, 2015

In cooperation with the U.S. Consumer Product Safety Commission